


Assembly Instructions



Model: Shade Net Kit 5.3'

Item No. 2532110

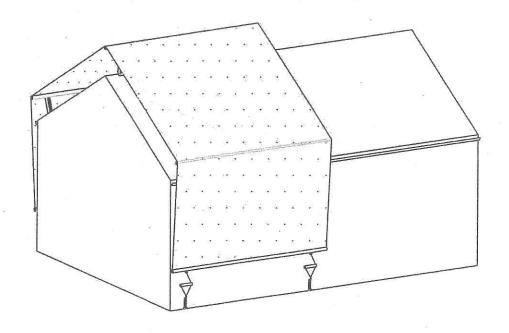

Cusamer Support
Support@ACFgreenhouses.com
1-888-888-9050

PARTS LIST

Stage 1

PART	N□.	Qty
0	L01A	2
(3)	L02A	2
~	Y1	1

Stage 2

PART	NO.	Qty.
5	L02A	3
	L03A	2
	L03B	4
>	W01	4
局	W02	4
0	W03	4
0<	W04	4

PART	NO.	Qty.
<u> </u>	W05	5
0	W06	4
	S01 M6X10	8
	M01 M6	8
4	Z01 Ø5X16	8
4	Z02 Ø4X16	6
0	J01	10

IMPORTANT:

Tools Required:


- *Screwdriver
- *Drill
- *Spanner


^{*}Please read these instructions carefully before assembling. *Please keep these instructions for future reference.


27.00	PART	NO.	Qty
Western	0	L01A	2
	S	LOŻA	2
	1	Y1	1


Stage 1

Each section of shading kit is in 1.6m modules (see page 4 for installation of additional modules).

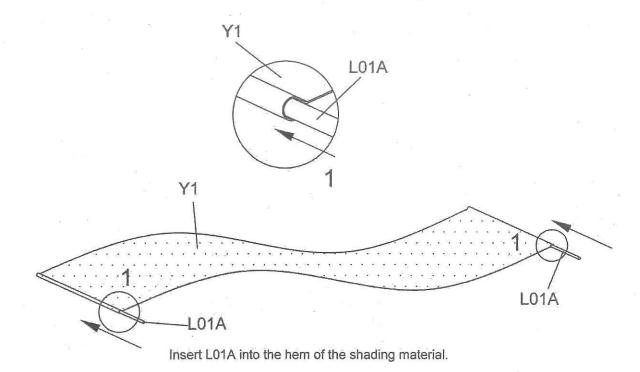

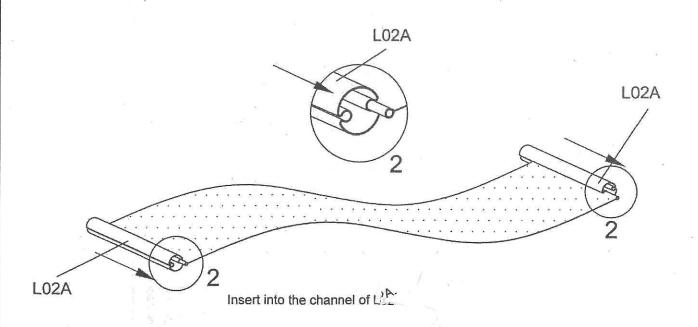


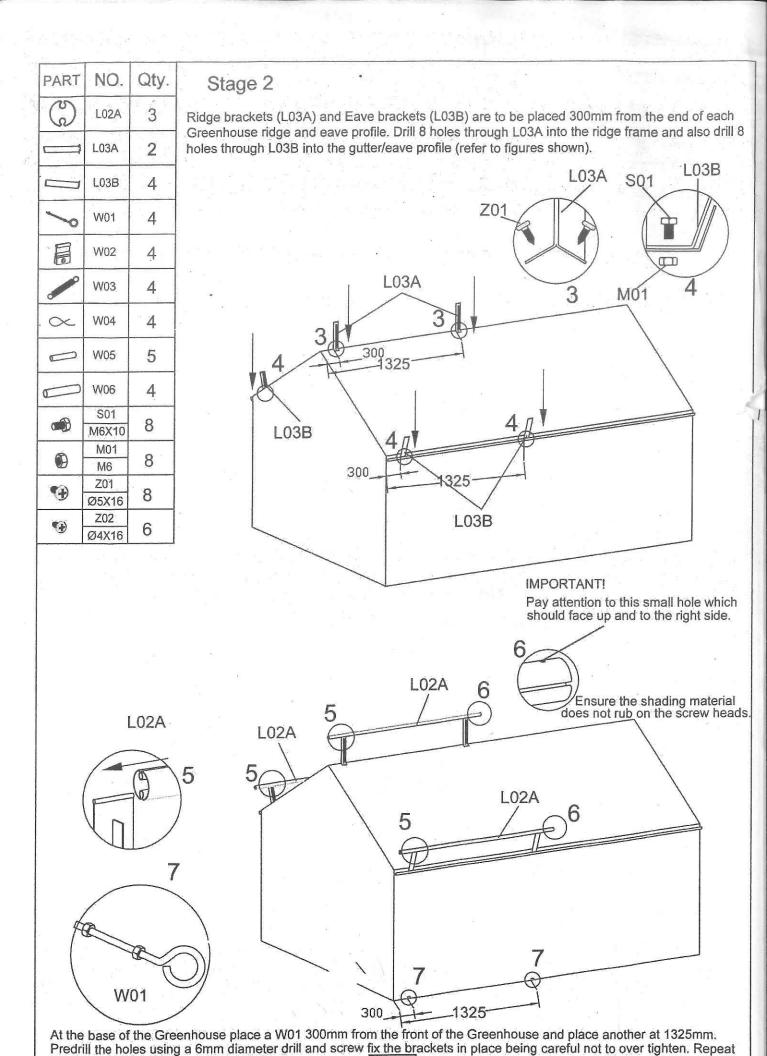

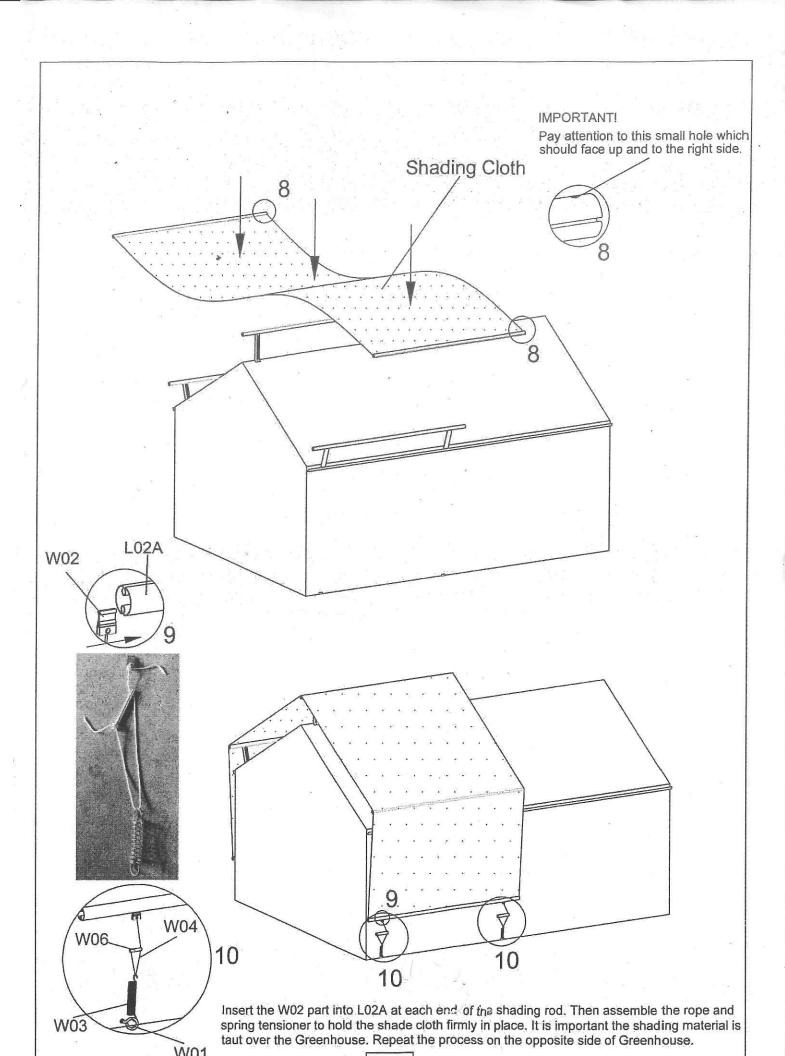


Assembly instructions for 4m shading kit

Ridge brackets (L03A) and Eave brackets (L03B) are to be placed 300mm from the end of each Greenhouse ridge and eave profile. Drill 8 holes through L03A into the ridge frame and also drill 8 holes through L03B into the gutter/eave profile (refer to figures shown).

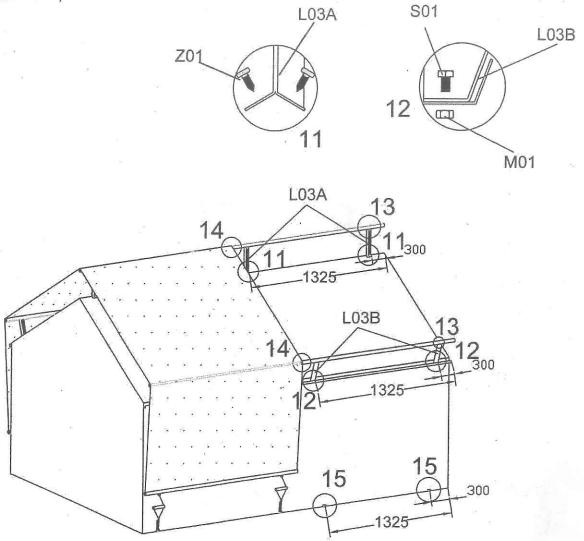


At the base of the Greenhouse place a W01 300mm from the back of the Greenhouse and place another at 1325mm. Predrill the holes using a 6mm diameter drill and screw fix the brackets in place being careful not to over tighten. Repeat the process on the opposite side of Greenhouse.

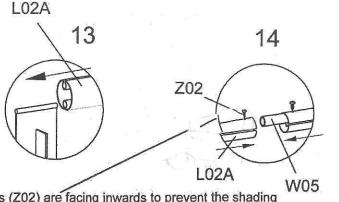

15 W01

Ensure the screws (Z02) are facing inwards to prevent the shading

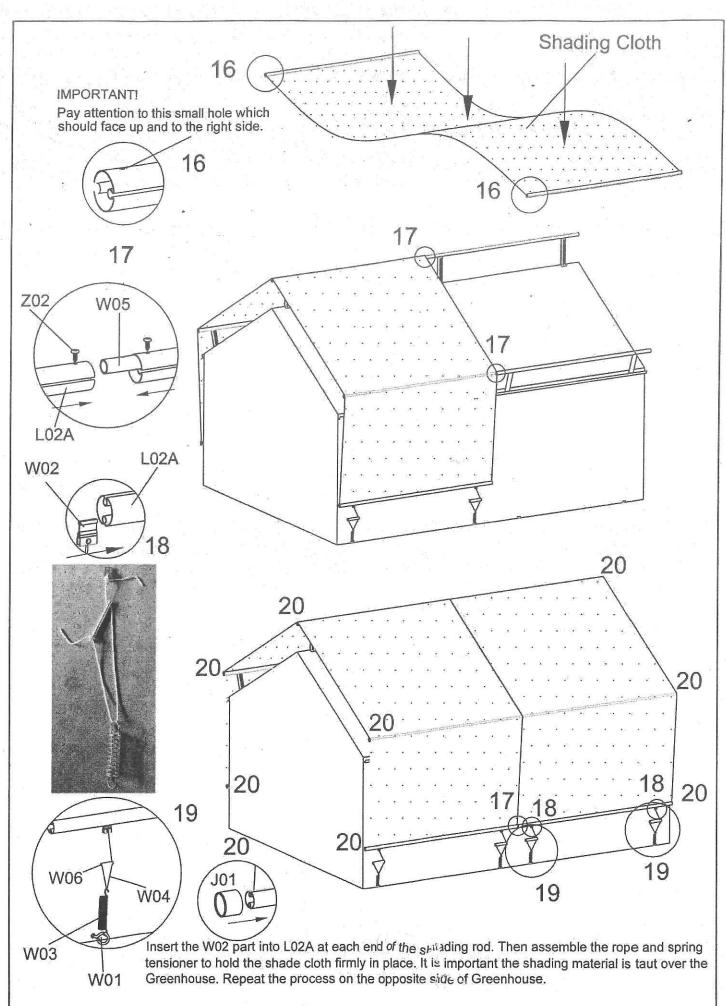

PLEASE NOTE: If your Grange Greenhouse exceeds 4mL and requires additional 2mL Shading modules the W05